

LAND CORNER RECORD

Index: R-5	Corner: Common Corner between Sections 19, 20, 29 and 30	State of Indiana - Hoosier National Forest
Section: 29	Township: 7N Range: 1E P.M.: 2nd	County: Monroe
Coordinate:	Lat./N: 1374368.49 Long./E: 3134843.04	Datum: NAD83 IN West Zone, US Survey Feet


CORNER HISTORY: (Chronological history of corner)

1.) Date of Survey:	Surveyor:	Monument:	Recording Information:		
10/16/2003	Robert Stone USFS Survey Tech	3" Iron pipe with a 3" stamped brass cap found	USDA Forest Service Bedford, IN		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
	Beech	11"	S16°W	6.00'	
	Hickory	17"	N71°W	3.40'	
	Hickory	14"	S68°E	39.20'	
Record evidence of prior survey:	A wood post was set and referenced in 1814 by Arthur Henrie, per the Original Government Notes.				
2.) Date of Survey:	Surveyor:	Monument:	Recording Information:		
4/7/2009	Kevin Enright Monroe County Surveyor	3" Stamped brass disk found	Monroe County Surveyor's Field Bk. 42, Pg. 29		
Reference Objects:	Species:	Diameter:	Bearing:	Distance:	
	Beech	13"	S10°W	5.25'	
	Metal "SURVEY" Sign	N/A	N86°W	0.54'	
	"V" in Cast Iron Fire Pit	N/A	S80°E	52.30'	
Record evidence of prior survey:	A 2-1/2" iron pipe was found and referenced in a Monument Record dated 3/26/1984 by Edmund Farkas, Monroe County Surveyor.				

ACCESSORIES: Bearing and distance from monument to witness object.

Reference Objects:	Object or Tree Species:	Diameter:	Bearing:	Distance:
	Beech* **	13"	S12°W	5.81'
	Pignut Hickory**	20"	N78°W	3.61'
	Pignut Hickory**	16"	S67°E	39.23'
	Cast Iron Fire Pit (center)	N/A	S78°E	52.70'
Monument Found or Set:	A 3" iron pipe with a 3" brass cap stamped "T7N R1E S.19 S.20 S.30 S.29 1978 S0143" found 1.0' above grade. 15" Sour Gum** is N30°E 48.18'.			


MONUMENT SKETCH

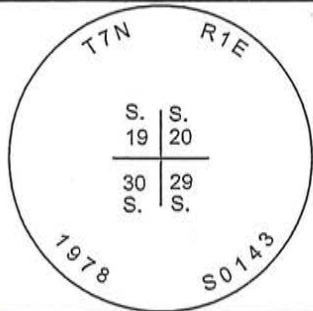

NARRATIVE REFERENCE:

Monument is a 3" iron pipe with a 3" brass cap stamped "T7N R1E S.19 S.20 S.30 S.29 1978 S0143" found 1.0' above grade, a carsonite post is located northwest 1.0' of the monument, located 100' northwest of Blue Gill Road, surrounded by mature forest, +/- 50' northwest of campground slot #131, south of a ravine to the north that bears west, S19°E +/- 250' to bathrooms for the campgrounds.

SECTION DIAGRAM

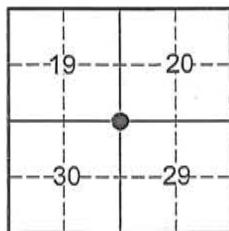

Corner Location = ●

PERPETUATION RECORD:

The record monument was found undisturbed and maintained by remarking the existing bearing trees. Three existing bearing trees were recovered from a Land Corner Record by Robert Stone, dated 10/16/2003 and remarked.

Bearing trees were marked with a blaze, scribed B.T., bearing tree sign, paint, and mag nail, unless otherwise noted.

Gray paint was placed over red paint on the bearing trees due to its location within a campground.

Referenced on BRCJ survey recorded as InstNo.2018004725.

Accepted by the Monroe County Surveyor Review Board on August 6, 2019.

Section: 29 T7N R1E	Prepared By: BRCJ (Project#3-0820)	Date: 2/2018
---------------------	------------------------------------	--------------

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 19

Township: 7 North


Range: 1 East

Corner ID: Polk E-17

Monument Description & Remarks: 3" Brass Disk stamped, "T7N R1E, S.19/S.20,S.30/S.29, 1978 S0134". Survey Sign 3.5ft above ground at pt. C

References On File: E. Farkas recovery tie drawing, Monument Record (1984), on file in Surveyor Office

RECOVERY TIE DRAWING
Field Book 42 Page No. 29

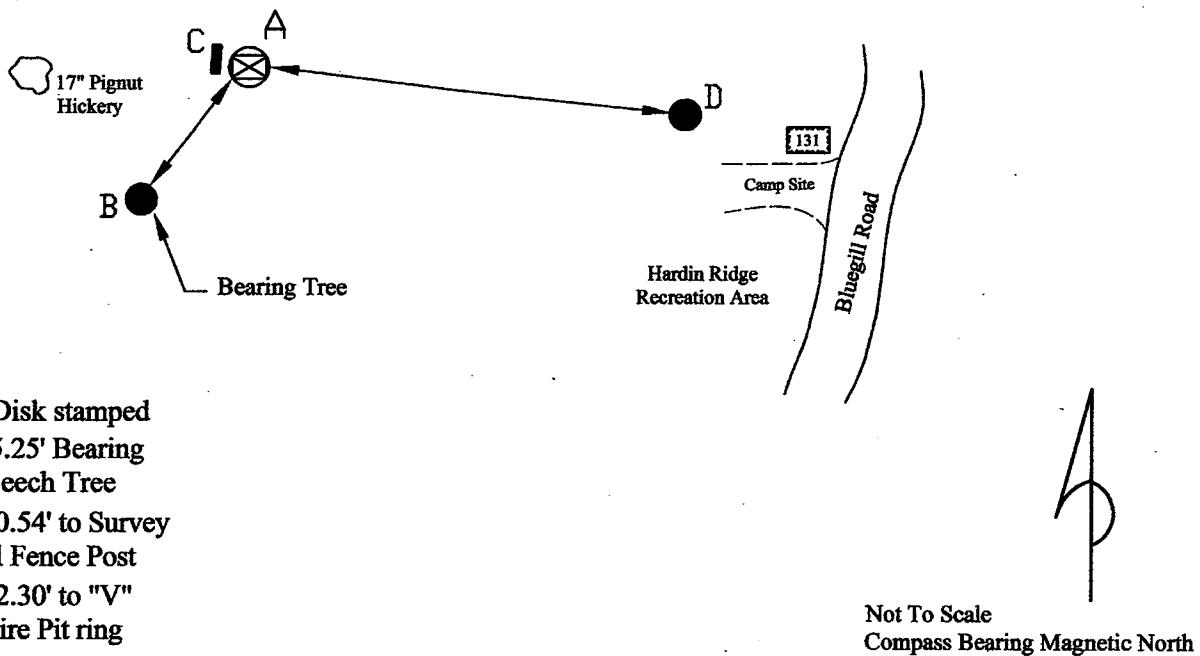


I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-11 of the Indiana Code; and the above data is given under my hand and seal this 19th day of March, 2009.

Kevin P. Enright

Administered by the Monroe County Surveyor Review Board

Date: 4-7-2009

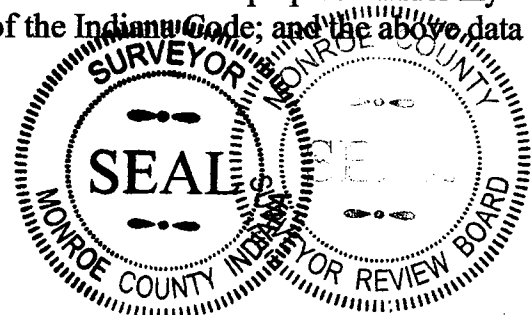

R5 Corner: S.C.

LAND CORNER RECORD

State of Indiana
Hoosier National Forest

Index:

Twnshp: 7N Range: 1E Section: 19,20,29,30 2nd P.M. County Monroe

EXISTING SURVEYS

Original Government Survey

Original Survey Evidence Found

Year Surveyed:	1814	By:	Arthur Henrie	Date of Search:		By:	
Original Monument:	Wood post			Monument Found:			
Species	Diameter	Bearing	Distance	Species	Diameter	Bearing	Distance
Poplar	25	S 10° E	24 links				
Gum	6	N 30° E	14 links				
Subsequent Corner Restoration				Evidence of Subsequent Corner Restoration Found			
Where Filed or Recorded:				Year Searched:	10/15/2003	By:	B.Stone
Book:				Monument Found	3" diameter steel pipe monument standing 10" above ground with a brass cap stamped as shown:		
Monument Set:							
Species	Diameter	Bearing	Distance	Species	Diameter	Bearing	Distance

OTHER EVIDENCE

Describe corner loc. relative to nearby features & dir. to corner location; note fences, roads, etc.	Sketch of Monument
The monument is located on the northwest edge of a broad ridgetop in Hardin Ridge Recreation Area. A treeline runs north and south. The in ground fire ring on Bluegill campsite #131 is 52.7 feet S 72° E from the monument. The paved road on Bluegill Ridge is approximately 125 feet east. A 5" x 10" x 19" triangular shaped stone with a possible + on the large end and scribing on the side is laying on top of the ground 1.8 feet north of the monument. Five other stone are laying within 2 feet of the monument.	

PERPETUATION RECORD

Monument: Describe new monument set or work done to perpetuate/preserve the existing monument/position.

Left monument as found					
Corner Diagram		Accessories: Describe new BTs & witness objects established to perpetuate existing evidence.			
		Beech (with old US bt shield tag 11" and old red paint at top S 16° W of root crown) 6.0 Ft.	Hickory 17" N 71° W 3.4 Ft.	Hickory (4 ft. west of fire ring) 14" S 68° E 39.2 Ft.	
		Corner Recordation:		Certificate Prepared:	
		Filed and Recorded in County records:		Date:	
		Book:		Page:	
		Geodetic Coordinates:		Lat./N.	Long./E.
Section: 20		Edited By: Robert J. Stone		Date Created:	10/16/2003

MONUMENT RECORD


STATE OF INDIANA - COUNTY OF MONROE

SECTION 19, TOWNSHIP 7 NORTH, RANGE 1 EAST

MONUMENT DESCRIPTION & REMARKS

FOUND 2 1/2" IRON PIPE SOLID IN GROUND PAINTED RED WITH
STAMPED CAP ON TOP DATE ON CAP IS 1978. PIPE IS 1' OUT OF
GROUND.

RECOVERY TIE DRAWING

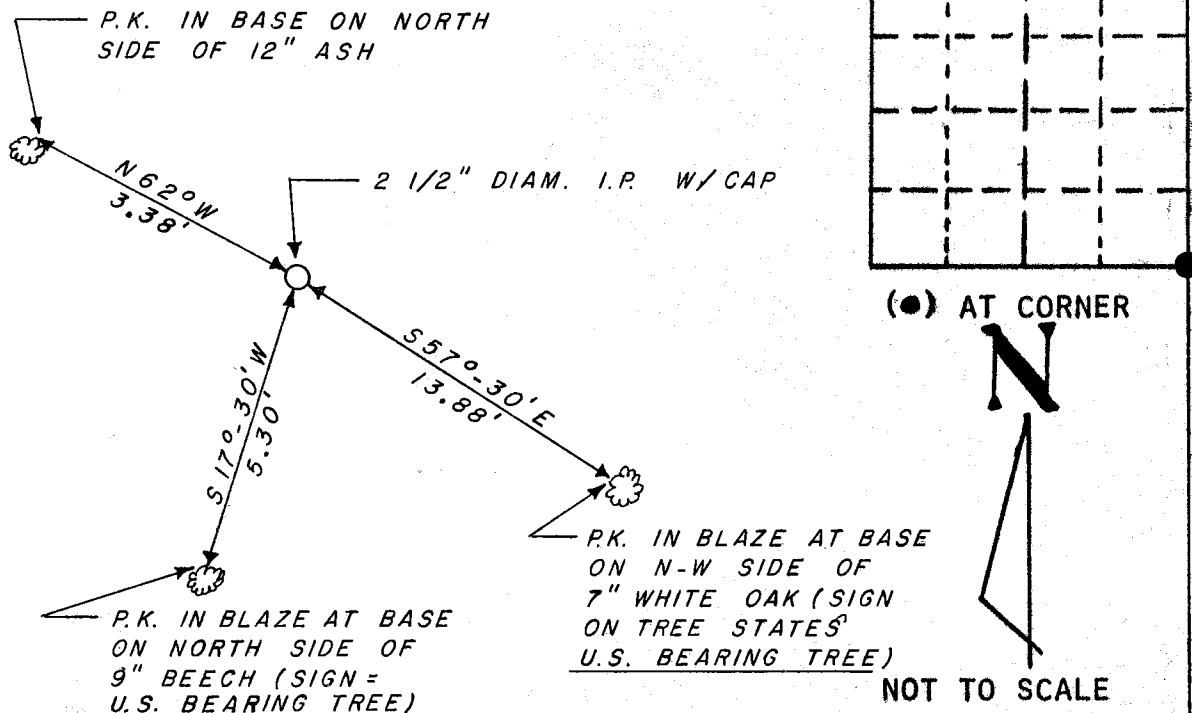

STATE OF INDIANA

COUNTY OF MONROE

I, EDMUND O. FARKAS HEREBY CERTIFY THAT THIS
DOCUMENT WAS PREPARED UNDER MY DIRECTION IN ACCORDANCE
WITH THE PROVISIONS OF SECTION 17-3-64-4 - 17-3-64-8 OF
THE INDIANA CODE, BEING ACTS OF 1965, CHAPTER 319; AND
THE ABOVE DATA IS GIVEN UNDER MY HAND AND SEAL
THIS 26 TH. DAY OF MARCH, 1984 A.D.

SPACE
RESERVED
FOR
RECORDING
OFFICER.

INDIANA REGISTERED LAND SURVEYOR NO. _____

OR _____

UNITED STATES GOVERNMENT AGENCY

TOWNSHIP:
POLK

CORNER I.D.

TITLE _____

E - 17

Index No. R-5
(Alphabetical - Numerical)


LAND CORNER RECORD
(RECTANGULAR SURVEYS)

R9-7150-4 (Rev. 6/13/67)
GPO 806-924

T. 7N R. 1E Mer. N.F. Hoosier County Monroe State Ind.
Section 30 Corner common to sections 19, 20, 29 and 30

EXISTING SURVEYS

Original Government Survey		Original Evidence Found	
Year surveyed		Year of search	By
Original monument	<u>Wood Post</u> (Wood post, stone, pile of stones, pipe, etc.)	Monument found	
Bearing Trees		Original Bearing Trees Found	
Species	<u>Poplar Gum</u>	Species	
Diameter	<u>25" 6"</u>	Diameter	
Bearing	<u>S10E N30E</u>	Bearing	
Distance	<u>24 1Ks 14 1Ks</u>	Distance	
Subsequent Corner Restoration		Evidence of Subsequent Corner Restoration Found	
Year surveyed	<u>1873</u> By <u>Wm. Henley</u>	Year of search	<u>1973</u> By <u>H. Denton</u>
Where filed or recorded	<u>Monroe Co Eng. Office</u>	Found	<u>5" x 2" # 7" out of ground found</u>
Monument	<u>Stone</u> (Original, concrete post, iron rod, etc.)		<u>Poster on tree set by CCC near stone</u>
Bearing Trees, Reference Objects		Bearing Trees, Reference Objects	
Species	<u>Poplar Ch. Oak</u>	Depression	<u>2"</u>
Diameter	<u>30" 12"</u>		
Bearing	<u>S20W S40W</u>		
Distance	<u>24 1Ks 30 1Ks</u>		

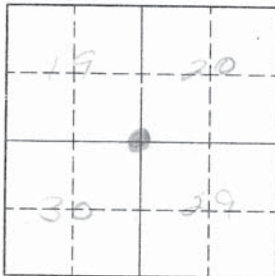

Sketch

○ Corner ■ F.S. Land

Relation of Evidence to Record Features Along Section Lines

Section line to sections _____
Object _____
Record distance _____
Measured distance _____

Other Evidence

Describe evidence of use and occupation such as roads, fences, clearings, timber cutting lines, plantations, etc.. Cite source of testimony if any.

Not enough evidence to verify the corner
so we marked the area with new bearing
tree

At time of search:

1. Did you have the record description?
Yes ✓ No _____

2. How was search area located?

Pacing, chaining, photos, maps,
etc. _____

3. Man hours spent in search 2 hrs.

4. Do you think additional search might
recover evidence? Yes _____ No _____

5. Signature H. Denton

Perpetuation Record

Monument and accessories established. Include brief description of area.

Found 5" x 2" # 7" out of ground found
W. Oak 4" Beech 5" Hickory 11"
S20W 3.6' S15W 5.6' N72W 3.6'

1974

Certified corner restoration certificate prepared: Yes _____ No _____
Filed in county records at _____ Date _____ County Document No. _____
Identified on aerial photo No. _____ Which is filed at _____